
Brushed Screwdriver VZ Series (AC Type) Transformerless

Transformerless screwdrivers suitable for heavy work

- Transformerless type with built-in controller.
- Can be directly plugged into an AC outlet.
- Light and slim balanced body design that minimizes operator fatigue.
- HIOS H5 bit and hexagonal bit with width across flats 5mm (5HEX) can be used.
 (Not applicable to VZ-1510 and VZ-1501PS)

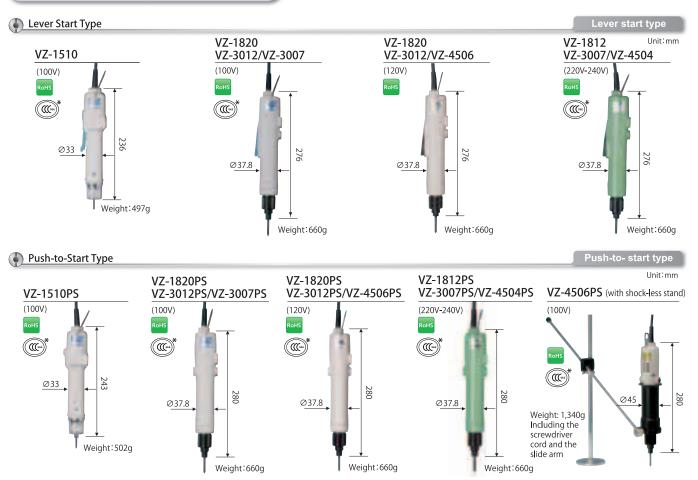

VZ Series Specifications

Specifications

Lever Start Model		VZ-1510	VZ-1812	VZ-1820		VZ-3007		VZ-3012		VZ-4504	VZ-4506	
Push-to-Start Model		VZ-1510PS	VZ-1812PS	VZ-18	320PS	VZ-3007PS		VZ-3012PS		VZ-4504PS	VZ-4506PS	
AC Input Power (±5%)		100V	220 - 240V	100V	120V	100V	220-240V	100V	120V	220 - 240V	100V	120V
Power Consumption (W)*1		26W	72W	40W	60W	40W	72W	40W	60W	72W	40W	60W
0	N∙m	0.15 - 1.5	0.4 - 1.8	0.4 - 1.8		0.9 - 3		0.9 - 3		1 - 4.5	1 - 4.5	
Output Torque	Ibf•in	1.3 - 13	3.5 - 16	3.5 - 16		7.8 - 26		7.8 - 26		8.8 - 39	8.8 - 39	
Range	(kgf·cm)	(1.5 - 15)	(4 - 18)	(4 -	18)	(9 - 30)		(9 - 30)		(10 - 45)	(10 - 45)	
Torque Switching		Stepless adjustment	Stepless adjustment	Stepless a	djustment	Stepless adjustment		Stepless adjustment		Stepless adjustment	Stepless adjustment	
Unloaded Rotation Speed (r.p.m) ±10%		1,000	1,200	2,0	000	700		1,200		400	600	
Screw Size	Machine Screw	2.0 - 4.0	2.6 - 4.0	2.6	- 4.0	3.0 - 5.0		3.0 - 5.0		3.0 - 5.0	3.0 - 5.0	
(mm)	Tapping Screw	2.0 - 3.0	2.6 - 3.0	2.6	- 3.0	3.0 - 4.0		3.0 - 4.0		2.6 - 4.0	3.0 - 4.0	
Bit HIOS Shank		H4	H5 and 5HEX	H5 and 5HEX		H5 and 5HEX		H5 and	d 5HEX	_	_	
HEX Sha	ınk	5HEX or 1/4HEX	1/4HEX	1/4HEX		1/4	1/4HEX 1/4HEX		1/4HEX	1/4HEX		
AC Screwdriver Cord Length		3m	3m	3m		3m		3m		3m	3m	
	H4	+#1 (⊘4×40mm) +#2 (⊘4×40mm)										
Bit (one each)	H5		+#1 (Ø5×60mm) +#2 (Ø5×60mm)	+#1 (Ø5 +#2 (Ø5	×60mm) ×60mm)		5×60mm)	+#1 (Ø5 +#2 (Ø5				
Acce			+#1 (5.0×50mm)	+#1 (5.0	×50mm)	+#1 (5.0	×50mm)	+#1 (5.0	×50mm)	+#1 (5.0×50mm)	+#1 (5.0	×50mm)
Accessories	1/4HEX		+#2 (5.0×50mm) — (5.0×50mm)		×50mm) ×50mm)		×50mm) ×50mm)	+#2 (5.0) (5.0)	×50mm) ×50mm)	+#2 (5.0×50mm) - (5.0×50mm)	+#2 (5.0) - (5.0)	×50mm) ×50mm)
Torque adju	stment spring	Red (∅1.5)										
Plus screw fo	or adjustment			M2.6 (pan head	machine screw)	M2.6 (pan hea	d machine screw)	M2.6 (pan head	machine screw			
Carbon brus	h (Order code)	1 pair (ACL10-0490)	1 pair (VZ18-0480B)	1 pair (VZ	Z18 - 0480)	1 pair (VZ	Z18-0480B)	1 pair (VZ	Z18 - 0480)	1 pair (VZ18-0480B)	1 pair (VZ	(18-0480)
Flat 2P conversi	Flat 2P conversion plug (only for 100V)			1pc (with g	round wire)	1pc (with	ground wire)	1pc (with g	round wire)	1pc (with ground wire)	1pc (with g	round wire)

^{*1} The value of power consumption is approximate estimate. *2 If you select the hexagonal shank, no bit is included. Please purchase standard-sized hexagonal bits from commercial stores (refer to P. 53).



Suction (Vacuum)

By making use of negative pressure, the effort needed to pick up screws can be reduced. This suction attachment can even pick up non-ferrous screws such as stainless steel screws by vacuuming, and improve operation efficiency. It can also be used to remove powder dust generated from screw tightening.

Order guide

(A) and (B) needed to be purchased separately if you have a suction-type screwdriver. (A), (B) and (C) needed to be purchased separately if you want to convert your screwdriver to a suction type.

* There are several options of sizes of (A) and (B) depending on the screw size. For more information on the size, please refer to P. 58.

N	lodel	(A) Mouthpiece model	(B) Bits total length	(C) Suction attachment model	
AC100V	VZQ-1510	F3-standard 18mm	H4 60mm	VZQ10-SET	
AC100V, AC120V, AC220V-240V	VZQ-1812、 1820、3007、 3012	F6-Standard 31mm	H5 100mm	VZQ18-SET	

For use with HIOS screw counters

Models:

(100V) VZ-1510-OPC (100V, 120V) VZ-1820-OPC

(100V) VZ-3007-OPC

(100V, 120V) VZ-3012-OPC (including PS type) VZ-4506PS-OPC (with shockless stand) (100V)

Compatible counter HIOS Screw counter VZOP-STC

► See P. 41-42 for details.

These screwdrivers prevent you from skipping screw tightening in combination with the screw counter.

• They have a function to output positive rotation, reverse rotation and torque-up (tightening complete) signals.

If you would like to purchase AC220V-240V type. please contact HIOS distributors.


CCC certified models

Note: CCC certified models have different specification and order codes from the standard models.


Please contact HIOS distributors before ordering.

Output torque guide

(Including PS type)

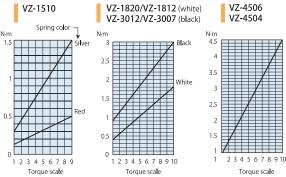

Plug type

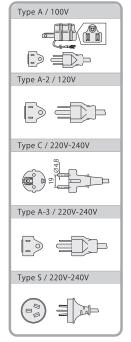

Accessories

Pistol Attachment

PA-18 (for Lever Start*)

PA-18PS (for Push-to-Start*)

This attachment converts a standard screwdriver to a pistol-style screwdriver, most suitable for horizontal tightening.



* Not applicable to VZ-1510 and VZ-1510PS

Angle Attachment

ANGLV-Z-CH1 (For HIOS H5 and 5HEX drive*) ANGLV-Z-XX1 (For 1/4 HEX drive)

This attachment is most suitable when the available space is very small for screw tightening. This attachment can be fitted to the

tip of the screwdriver. The output torque should be 1.8N·m or lower when you use





Compatible screwdrivers:

VZ-1820 VZ-3007 VZ-3012 (Lever Type only)

*The bit drive for ANGLV-Z-CH1 is H5. Please contact HIOS distributors for ANGLV-Z-CH1 to use with 5HEX drive bits.

PS Front Cover Ring

VZ18-0960

This helps you to easily apply load in the axial direction to reduce workload.





Protective Cover for Torque Adjustment Nut

VZ18-0970

This cover prevents deviation from set torque due to a shock or malfunction.





Shockless Stand VZ18PS-SAS

The shockless stand absorbs reaction force created by the clutch. This stand can be used only with Push-to-Start-type screwdrivers.



Yellow